





REVEL HUTCH


Spanish translation of item description

REVEL HUTCH INSTALLATION INSTRUCTIONS


IMPORTANT SAFETY INSTRUCTIONS- SAVE THESE INSTRUCTIONS

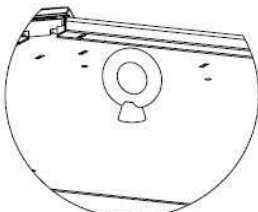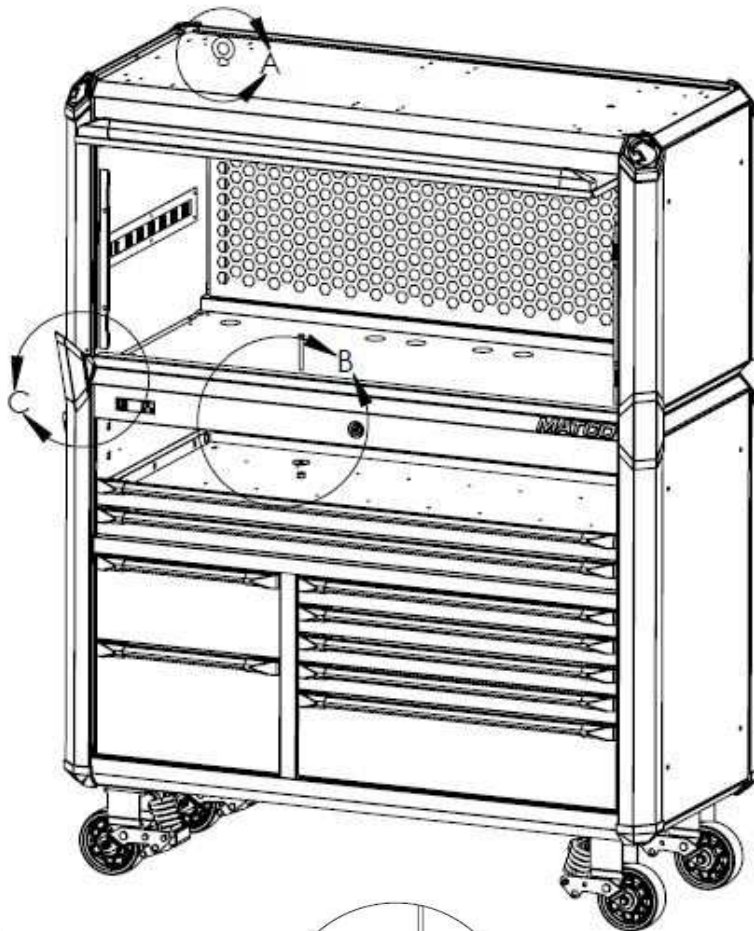

DETAIL A

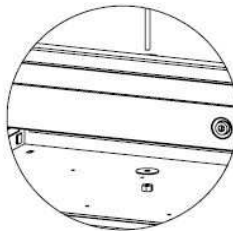

DETAIL B

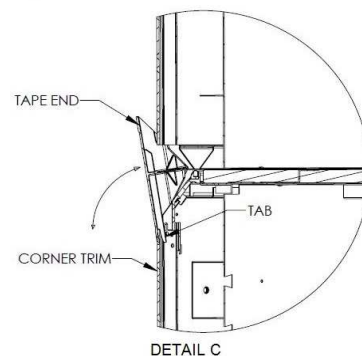

DETAIL C

Serial No. Range (After) - XXXXX
Rev. Level - A



REVEL HUTCH

Spanish translation of item description

REVEL HUTCH INSTALLATION INSTRUCTIONS

WARNING! REVEL HUTCHES MUST ONLY BE INSTALLED ON A TOOLBOX OF THE SAME SERIES OR SERIOUS INJURY MAY OCCUR.

WARNING! ALL TOP ADD ONS MUST BE MOUNTED SECURELY TO A TOOLBOX BEFORE USE!

REVEL HUTCH STACKING & MOUNTING INSTRUCTIONS.

1. Remove top mat or phenolic from top of toolbox. If stacking a hutch, remove top mat or phenolic from inside of hutch.
2. Using the quick disconnect feature on the drawer slide, remove the top drawer from the toolbox.
3. Remove (4) top caps from each corner of the toolbox by grasping, pulling, or prying. Once the top caps have been removed, the inner caps are visible.
4. To lift your top accessory, insert 2 eyebolts through the 5/8" holes in the top of the accessory (see detail "A") and secure with flat washers and nuts from the underside.
5. Before lifting the top accessory, be sure all doors / drawers are closed and locked, verify that the eyebolts are secure.
6. Slowly lift the top accessory onto the toolbox, open the accessory, and remove the eyebolts. Align the side and back of the accessory to the top of the toolbox.
7. Open hardware pack (HDWE_TCHEX). Place a washer onto each bolt and place from top down into The mounting holes (see detail "B"). Place a washer and nut onto each bottom of the bolts inside the toolbox and tighten.
8. Remove the adhesive backer strip on the CAP_STACK (see detail "C"). Align bottom of the cap with the top of the Corner trim on the toolbox as shown in detail "C". There are tabs on the inside of the CAP_STACK that go behind the corner trim to help with alignment. Then rotate the cap up and press in place. Tap lightly with a soft mallet to fully seat into place as needed. Repeat on remaining corners.
9. Replace all drawers, mats, and/or phenolic tops.
10. Plug hutch power strip into junction box outlet on the back of the toolbox.
11. Make sure all power cords are routed as to not touch the floor. Use of the MAG-CLIP supplied with the toolbox is recommended.